


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-154	Smoke	4/13/2009	ADS/TM	S13A_007MH	Dry	Yes	1,936.82

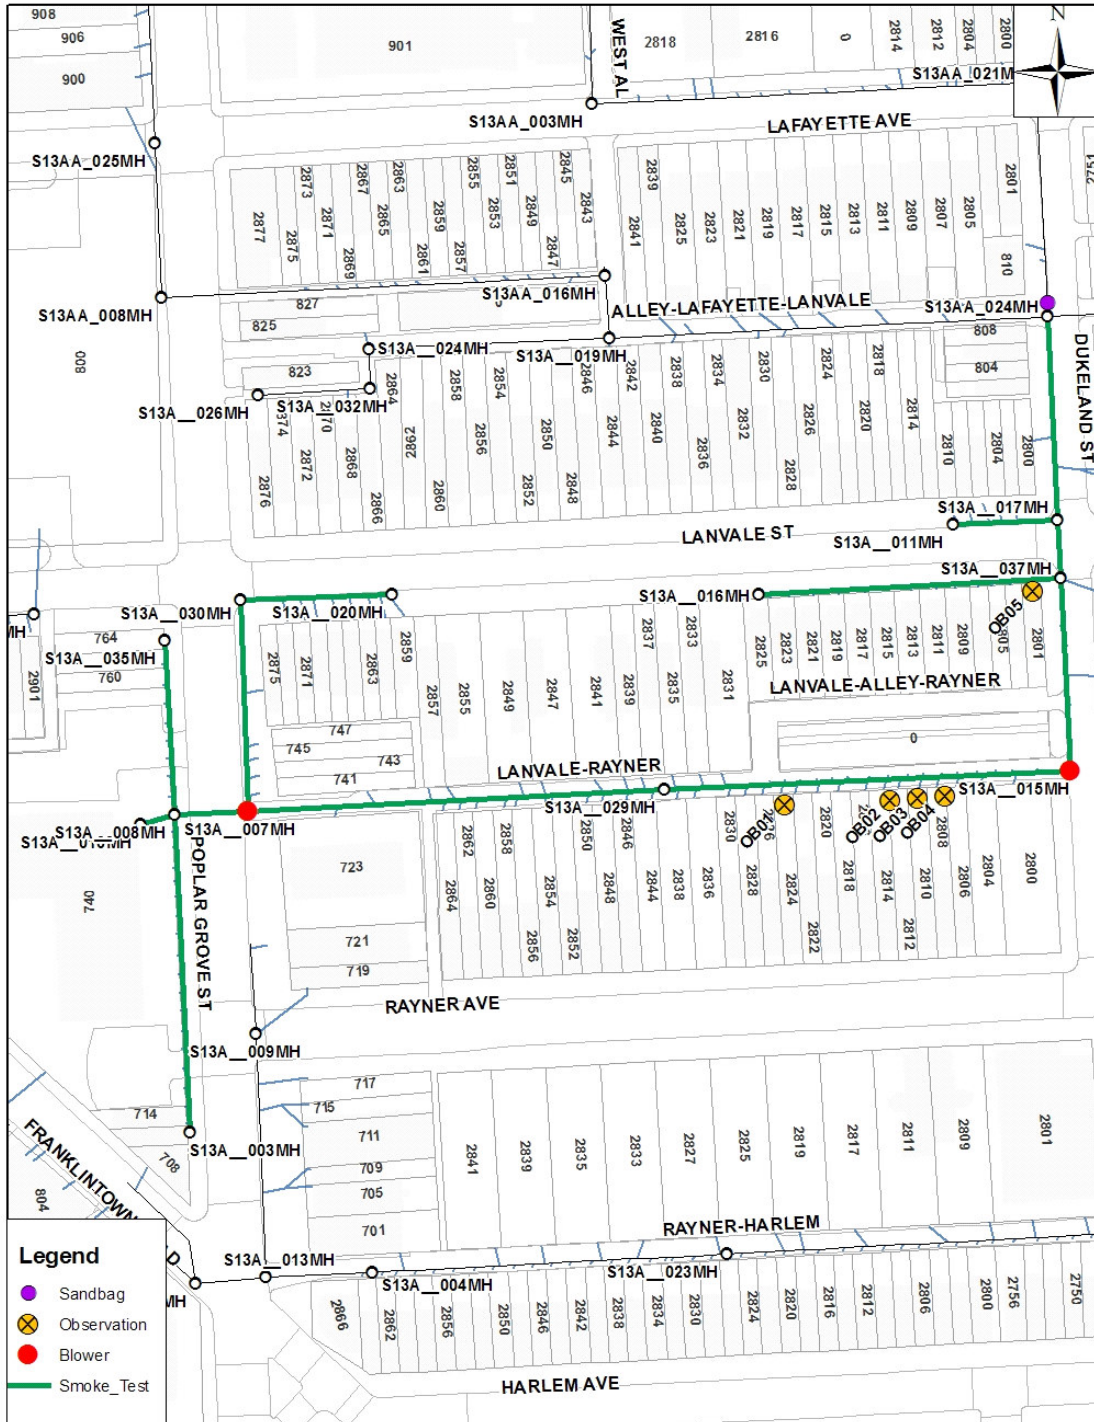

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-154	Smoke	4/13/2009	ADS/TM	S13A__007MH	Dry	Yes	1,936.82

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S13A__016G1	S13A__016MH	S13A__037MH	220.9171	8
S13A__003G1	S13A__003MH	S13A__008MH	232.3265	8
S13A__011G1	S13A__011MH	S13A__017MH	76.23298	8
S13A__020G1	S13A__020MH	S13A__030MH	110.9250	8
S13A__015G1	S13A__015MH	S13A__037MH	141.0376	8
S13A__008G1	S13A__008MH	S13A__007MH	53.92296	8
S13A__035G1	S13A__035MH	S13A__008MH	128.1855	8
S13A__017G1	S13A__017MH	S13AA__024MH	148.7727	8
S13A__030G1	S13A__030MH	S13A__007MH	154.5646	8
S13A__037G1	S13A__037MH	S13A__017MH	43.11341	8
S13A__007G1	S13A__007MH	S13A__029MH	303.793	8
S13A__029G1	S13A__029MH	S13A__015MH	297.1789	8
S13A__010G1	S13A__010MH	S13A__008MH	25.85148	8

Observations & Photos

Obs_ID S1028-154-OB01

Address 2824 Rayner Avenue

Status Private

Source Cleanout

Location Paved concrete

Nearest MH S13A__029MH

Comments Smoke from cleanout in paved concrete area behind house. 2824 Rayner Avenue



Picture \S1028-154-OB01-P01.jpg

Comments Back of house, 2824 Rayner Avenue

Obs_ID S1028-154-OB02

Address 2812 Rayner Avenue

Status Private

Source Cleanout

Location Yard - back

Nearest MH S13A__015MH

Comments Smoke from cleanout in back yard. 2812 Rayner Avenue



Picture \S1028-154-OB02-P01.jpg

Comments Back of house, 2812 Rayner Avenue



Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-154	Smoke	4/13/2009	ADS/TM	S13A__007MH	Dry	Yes	1,936.82

Obs_ID S1028-154-OB03

Address 2810 Rayner Avenue

Status Private

Source Cleanout

Location Yard - back

Nearest MH S13A__015MH

Comments Smoke from cleanout in back yard. 2810 Rayner Avenue



Picture \S1028-154-OB03-P01.jpg

Comments Back of house, 2810 Rayner Avenue

Obs_ID S1028-154-OB04

Address 2808 Rayner Avenue

Status Private

Source Cleanout

Location Yard - back

Nearest MH S13A__015MH

Comments Smoke from cleanout in back yard. 2808 Rayner Avenue



Picture \S1028-154-OB04-P01.jpg

Comments Back of house, 2808 Rayner Avenue

Obs_ID S1028-154-OB05

Address 2801 Lanvale Street

Status Private

Source Stairwell Drain

Location Yard - front

Nearest MH S13A__037MH

Comments Smoke from stairwell drain in front of house. 2801 Lanvale Street



Picture \S1028-154-OB05-P01.jpg

Comments Front of house, 2801 Lanvale Street

